

CRITICAL INSTRUCTIONS

Application: **Audi / Skoda / Volkswagen 2.5LD**

Part Number:

454135-5009S /

454135-5010S

WHEN FITTING THIS TURBO, IT IS **CRITICAL** THE FOLLOWING INSTRUCTIONS ARE ADHERED TO:

- **Check Breather System**

Replace filter and fit additional parts when replacing turbocharger

The engine breather system has a tendency to become restricted over time, causing an increase in sump pressure. The increased oil pressure inside the turbocharger causes oil to pass into the exhaust and air intake systems, resulting in blue engine smoke. This may occur after a new turbocharger has been fitted, even if the vehicle wasn't previously displaying this problem. Replacing the filter resolves the issue and the additional parts prevent it from occurring again.

Bracket: 059115405D

Trim: 059103547B

Any questions regarding the above should be directed to the supplier of this unit before commencing any work

