

# CRITICAL INSTRUCTIONS

Application: Mercedes Sprinter

Part Number:  
10009880036/  
10009880036E  
10009880074/  
10009880074E

WHEN FITTING THIS TURBO, IT IS **CRITICAL** THE FOLLOWING INSTRUCTIONS ARE ADHERED TO:

- **Pipes and supports required when replacing turbo**

When replacing a 10009880008/10009880008E (In production between September 2008 and December 2010, fitted up to engine 30468350) with a 10009880036/10009880074, additional components are required which need to be sourced directly from the Main Dealer:

Charge air pipe A 906 528 5082 or -5182\*

Coolant pipe A 906 501 1482


Support A 651 096 2940

Support A 651 096 3040

Screw (3x) N 910143 006001

\*Use -5182 if vehicle has optional equipment codes H08, N63 or HK4

This is due to a geometrical difference between the two products and without the additional products, the replacement turbo will not be able to be fitted.

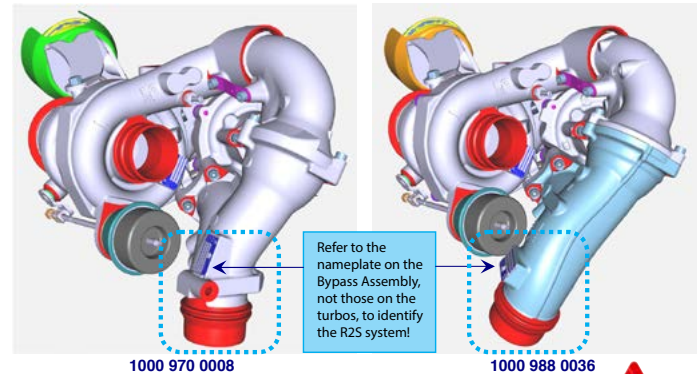

Any questions regarding the above should be directed to the supplier of this unit before commencing any work

